# Ball Lock Pins · self-locking, with button handle

22340 0229



## **Product Description**

For quick fastening, locking, adjusting, changing and securing. Quickly and easily unlockable for frequently repeated connections.

All versions are corrosion resistant. When using stainless steel 1.4542: high-strength, hardened, abrasion resistant pin with high load capacity. Compact design with button handle.

#### **Material**

## Pin part

· Stainless steel 1.4305

#### Handle

• Aluminium, black similar to RAL 9005

#### Press button

· Stainless steel, black

## **Spring**

· Stainless steel

## **Operation**

The balls are unlocked by pressing the button.

## Characteristic

Types from stainless steel 1.4542 with marking below the balls.

#### More information

#### **Notes**

Special types on request.


#### **Accessories**

Can easily be fitted with retaining cable EH 22400.

## **Further products**

- Locating Bushings, for ball lock pins and socket pins
- Locating Bushings, with flange, for ball lock pins and socket pins
- Retaining Cables
- Positioning Bushings, with collar, DIN 172 A
- Positioning Bushings, without collar, DIN 179 A
- Ball Lock Pins with Button Handle, single acting - comply with NAS / MS17984

# **Drawing**

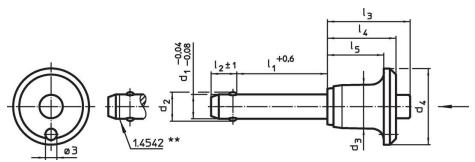

Erwin Halder KG

\*\* Types from stainless steel 1.4542 with marking.

www.halder.com Page 1 of 2


Published on: 10.8.2024

## **Order information**

d <sub>1</sub>										min.	max.	Ĭ	Shearing resistance, two-shear <sup>1)</sup>	Art. No.	
-0.04 -0.08	+0.6			[r	±1 nm]				[mm]	[°0	c <sub>]</sub>	[g]	min.		
Stainle	Stainless steel Stainless stee														
6	45	7	11.3	20	7	20.7	17.6	14.6	6	-30	150	20	21	22340.0229	

<sup>1)</sup> Shearing resistance similar to DIN 50141

## **Application example**

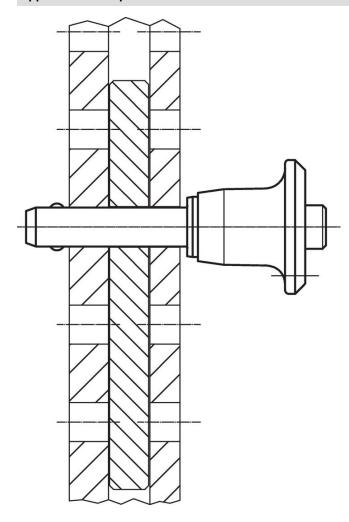

# Compliance

## Non-RoHS compliant

Not compliant according to Directive 2011/65/EU and Directive 2015/863.

## Contains SVHC substances >0,1% w/w

Contains lead - SVHC list [REACH] as of 27.06.2024.

## **Contains Proposition 65 substances**



Lead can cause cancer and reproductive harm from exposure https://www.P65Warnings.ca.gov/

## **Free from Conflict Minerals**

This product does not contain any substances designated as "conflict minerals" such as tantalum, tin, gold or tungsten from the Democratic Republic of Congo or adjacent countries.



www.halder.com Page 2 of 2
Published on: 10.8.2024