
# 螺纹顶上销·自锁,带把手

#### 22354 5008

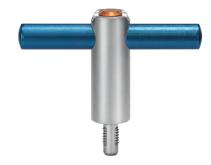

### 产品描述

T型手柄的把手可以经由手来移动或输送工件,例如, 零件成品组件,工件夹持系统,扬声器和其 他容器。

Heavy-duty lifting element with handle for quick and easy use. For lifting loads, the threaded lifting pin is inserted into a threaded hole. In contrast to a ringbolt, time-consuming screwing in and out is therefore unnecessary.

抗腐蚀和摩擦,因此适用于户外。非常扎实,高负载力的沉淀硬化销。

#### 材质

#### 梢子零件

• 不锈钢 1.4542、沉淀硬化

### 把手

• 铝,蓝电镀

#### 按钮

• 铝,橘色,阳极

### 螺纹元件

• 不锈钢 1.4542、沉淀硬化

#### 弹簧

不锈钢

#### 组装

Threaded lifting pins can be mounted into a thread that is true to gauge.

#### Mounting:

- 1. Press in the button and hold it down.
- 2. Insert the threaded lifting pin.
- Release the button (The button must be back in its original position. A clearly visible green marking on the press button indicates the correct position.).
- 4. Tighten the threaded lifting pin by hand, until it bears compleately on the bearing surface.
- It must be ensured that the threaded segments are engaged in the mounting thread.


#### Dismantling:

- 1. Unscrew the threaded lifting pin approx. a quarter of a turn anticlockwise.
- 2. Press in the button and hold it down.
- 3. Remove the threaded lifting pin.
- 4. Release the button.

#### 操作

Each threaded lifting pin is supplied with operating instructions. This document is also available for download as a PDF.


### 图面

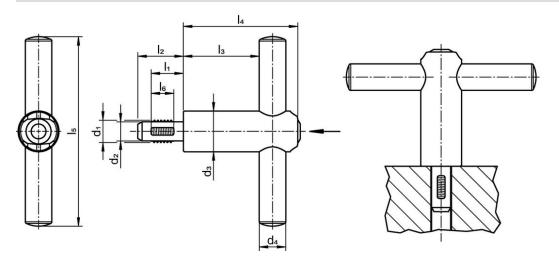

### 订单信息

尺寸										荷重能力	定位螺牙		I	品号
d <sub>1</sub>	I <sub>1</sub>	<b>d</b> <sub>2</sub> -0,07	$d_3$	d <sub>4</sub>	l <sub>2</sub>	l <sub>3</sub>	I <sub>4</sub>	l <sub>5</sub>	I <sub>6</sub>	F <sub>1</sub>		max.		
[mm]										[N]	[mm]	[°C]	[g]	
М8	12	6,62	21,5	14	17,3	40	60,3	100	8	500	M8	250	194	22354.5008

# 应用范例

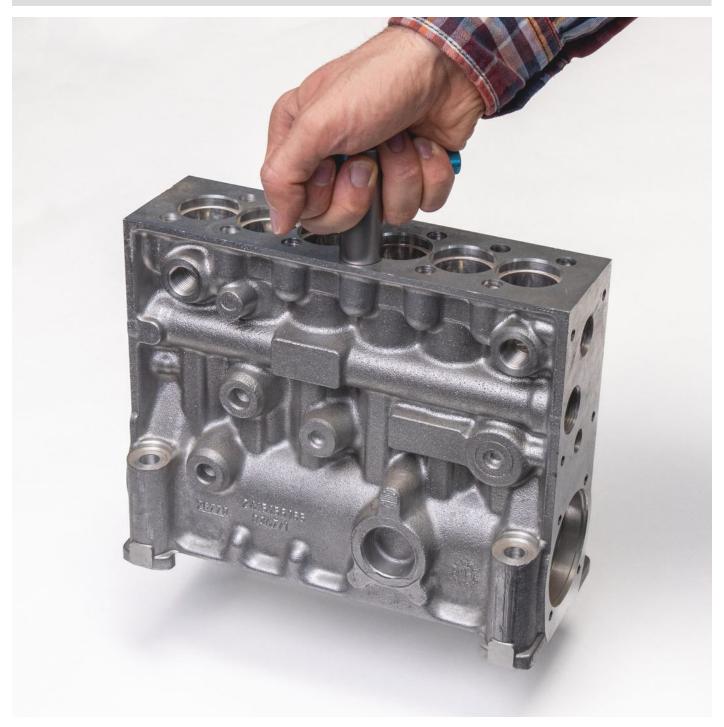











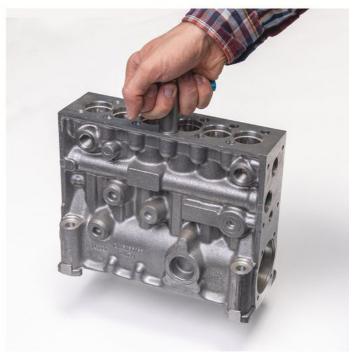

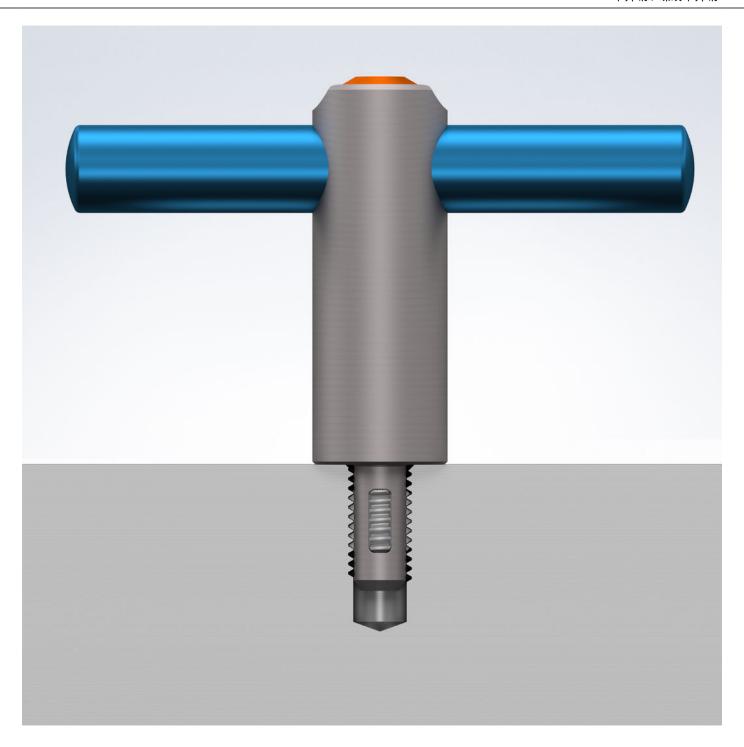

# 遵守

### 不符合 RoHS

不符合指令 2011/65/EU 和指令 2015/863

# 含有 >0.1% w/w 的 SVHC 物质

含铅 - SVHC [REACH] 清单截至 2024 年 6 月 27 日

# 包含 65 号提案的物质



铅暴露会导致癌症和生殖伤害 https://www.P65Warnings.ca.gov/

#### 不含冲突矿物

"本产品不含来自刚果民主共和国或邻近国家的任何被指定为"冲突矿物"的物质,例如钽、锡、金或钨。

