# **Socket Pins** • with spring-loaded balls

## 22400.0062



### **Product Description**

For quick fastening, locking, adjusting, changing and securing. Quickly and easily unlockable for frequently repeated connections.

All versions are corrosion resistant.

Version with ergonomic grip.

#### **Material**

#### Pin part

• Stainless steel 1.4305

#### Handle

· Thermoplastic PA 6, grey

#### **Spring**

· Stainless steel

#### More information

#### Notes

Security note: balls are spring-loaded and not locked as in article groups EH 22340., EH 22350., EH 22360., EH 22370. and EH 22380.


#### **Accessories**

Can easily be fitted with retaining cable EH 22400.

#### **Further products**

- Locating Bushings, for ball lock pins and socket pins
- Locating Bushings, with flange, for ball lock pins and socket pins
- Retaining Cables
- Positioning Bushings, with collar, DIN 172 A
- Positioning Bushings, without collar, DIN 179 A

### **Drawing**

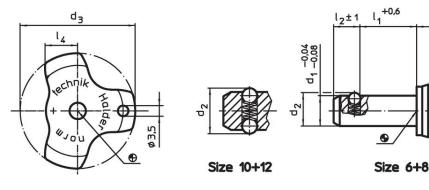

Erwin Halder KG


### Order information

Dimensions								Location hole H11	Shearing resistance,	Tensile force max.			I	Art. No.
<b>d</b> <sub>1</sub> -0.04 -0.08		d <sub>2</sub>	d <sub>3</sub>	d₄	l <sub>2</sub> ±1	l <sub>3</sub>	I <sub>4</sub>		two-shear	unlubricated	min.	max.		
[mm]								[mm]	[kN]	[N]	[°C]		[g]	
6	10	6.5	38	17.3	5	27	10.8	6	22	8	-30	80	16	22400.0062

www.halder.com Page 1 of 2

Published on: 10.8.2024

### **Application example**

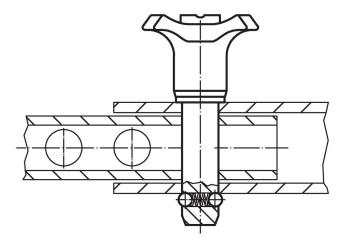

### Compliance

#### **RoHS** compliant

Compliant according to Directive 2011/65/EU and Directive 2015/863.

### Does not contain SVHC substances

No SVHC substances with more than 0.1% w/w contained - SVHC list [REACH] as of 27.06.2024.

Erwin Halder KG

### Does not contain Proposition 65 substances

No Proposition 65 substances included. https://www.P65Warnings.ca.gov/

### **Free from Conflict Minerals**

This product does not contain any substances designated as "conflict minerals" such as tantalum, tin, gold or tungsten from the Democratic Republic of Congo or adjacent countries.



Page 2 of 2 Published on: 10.8.2024

www.halder.com