Rubber Endstop Buffers • cylindrical

25150.1376



Product Description

To be used as an elastic end-stop, bearing foot etc.

The hardness is 55 \pm 5° shore A. Further shore hardnesses (40 \pm 5° shore A and 70 \pm 5° shore A) on request.

Material

Support washer

Stainless steel 1.4301

Threaded bushing

• Stainless steel 1.4301

Body


· Rubber natural caoutchouc (NR), black

More information


Further products

· Support Legs, impact cushioning

Drawing

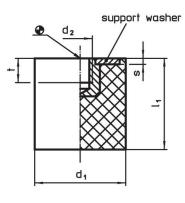

picture 1

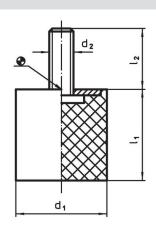



picture 2

Order information

| Dimensions | | | | | Spring rate R | Load capacity | Spring range | | | I | Art. No. |
|---|----------------|----------------|---|---|---------------|---------------|--------------|------|------|-----|------------|
| d ₁ | I ₁ | d ₂ | s | t | ~ | max. | _ | min. | max. | | |
| [mm] | | | | | [N/mm] | [N] | [mm] | [°C] | | [g] | |
| with female thread – picture 1, Stainless steel | | | | | | | | | | | |
| 75 | 30 | M12 | 3 | 9 | 600 | 4500 | 7.5 | -30 | 80 | 210 | 25150.1376 |

Application example

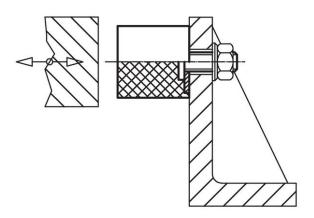

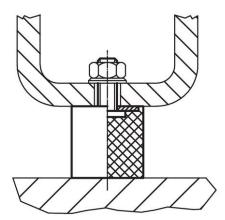



www.halder.com Page 1 of 2
Published on: 10.8.2024

Compliance

RoHS compliant

Compliant according to Directive 2011/65/EU and Directive 2015/863.

Does not contain SVHC substances

No SVHC substances with more than 0.1% w/w contained - SVHC list [REACH] as of 27.06.2024.

Does not contain Proposition 65 substances

No Proposition 65 substances included. https://www.P65Warnings.ca.gov/

Free from Conflict Minerals

This product does not contain any substances designated as "conflict minerals" such as tantalum, tin, gold or tungsten from the Democratic Republic of Congo or adjacent countries.



nalder.com Page 2 of 2 Published on: 10.8.2024

www.halder.com

Erwin Halder KG